



TECHNICAL FIELD BULLETIN



Date February 2004
Subject Door Sensors for Safes with AuditLok XL Electronics and BSD Hardware
Issue By NKL Cash Handling - a member of FKI Security Group
Issue To NKL Service Partners, Dealers, Distributors, NAMs/BDMs
Document 40206

OVERVIEW

Door sensors on BSD safes have been changed. The new door sensors offer improved reliability. The outer door sensor was changed from a switch on the inner door push rod to a plunger mounted on the hinge side inner sill. A similar plunger sensor is now being installed on the inner door to track inner door status.

PRODUCTS AND SERIAL NUMBERS AFFECTED

Model	First Serial Number with New Sensors
BSD2620	SP2003049107
BSD2920	SP2003049010
BSD3220	SP2004003100
BSD4125L	SP2004002065
BSD4125R	SP2003049081
BSD4725	SP2004002059

ACTION REQUIRED

Do not attempt to upgrade a door sensor on an older safe. If a sensor fails, replace the sensor with the same style part. Note that any time a door sensor is changed it is necessary to contact NKL Technical Service (1-800-452-4655) for an override to enable the sensor.

ADDITIONAL INFORMATION

The new sensors are built into the lock cable harness. The following part numbers are provided for reference purposes:

	Old #	New #
Outer Lock Harness	15021825	15025825
Inner Lock Harness	15014000	15025901

NKL Cash Handling is a member of the FKI Security Group.
101 Security Parkway - New Albany IN 47150
1-800-528-9900 - www.nklcashhandling.com

